RISO INC. **TECHNICAL INFORMATION BULLETIN**

Subject: New Style Drum PCB | Bulletin No: 38

☐ Factory Modification ☐ Field Modification ☐ Safety Information ■ Technical Information ☐ General Information ☐ Adv. Tech Information	Applies to: New Style Drum PCB RG	Modification Schedule: ☐ TBS ☐ Next Call ☐ Next PM ☐ As Necessary	Factory Installed _____ Field Installed _____ Fitting TIme _____

Problem: No Ink supplied to drum

Cause: 1) Bad solder connection on Ant-2
2) Position of coil L2
3) Antenna sensitivity

Solution: 1) Resolder Antenna
2) Reposition/reform L2, C9, C12
3) Replace R14 on drum PCB to 33KR Resistor

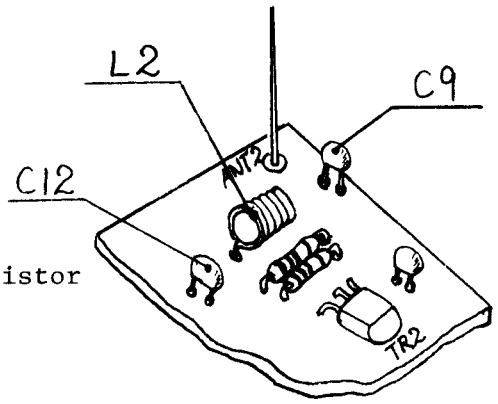

Problem: T4 too much ink supplied to drum

1) Antenna sensitivity

Solution: 1) Replace R14 drum PCB with 27KR resistor
2) Reposition/reform L1, C2, C5

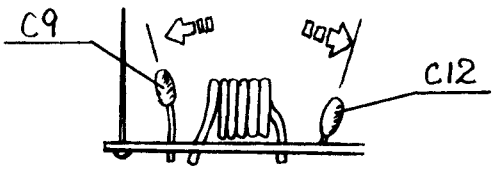

Correct

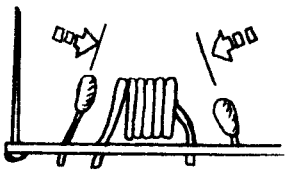

Incorrect

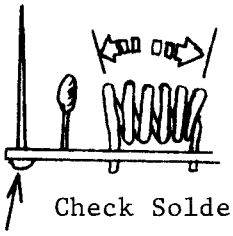

Check Solder

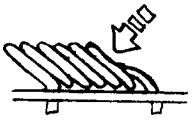

Incorrect

Issue Date	Effective Date	Supersedes Bulletin	Date	Page No. 1 of :
4/18/89	4/18/89		4/18/89	1